

	INSPECTION REPORT	Report Date:	Mar 25. 2008	Overall Result PASS
		Booking No.:	N/A	
		Inspection No.:	2003-01	6 pages
		Client Name:		

Vendor/Supplier:		Defect	Actual found	Allowed limit
		Critical	0	0
Factory Name:	N/A	Major	2	10
		Minor	5	14
Inspection Date:	Begin: date- Mar 25.2008 Time-10:00	End: date- Mar 25. 2008	Time-16:00	

	Product Description: Super bright led slim book light									
P.O.No.	Item/Style/Sku	Ordered Quantity		Supplied Quantity		Packed Quantity		Unpacked Quantity		Barcode
		Units	Ctns	Units	Ctns	Units	Ctns	Units	Ctns	
2003-01	ILMBLT	6000	60	6000	60	6000	60	0	0	N/A
Total:	N/A	6000	60	6000	60	6000	60	0	0	N/A

INSPECTION RESULT SUMMARY					
	PASS	FAIL	PENDING	N/A	REMARK
PRODUCT TYPE	X				
WORKMANSHIP	X				
ON-SITE TESTS	X				
PACKING&ASSORTMENT	X				
LABELING,PRINTING&MARKING	X				

A.GENERAL	
From: Wenzhou Trust Testing & Inspection Co., Ltd.(TTC) Contact: Vicky Lin Tel: 0086-577-88915592 Fax: 0086-577-88915610 Email:ttctest@gmail.com Inspector Name(s):Benjamin Zhang	
Service Performed: FRI	Ref. Sample Received Date: February 4 th , 2008
Total qty of Export Ctns:60CTNS	Number of Export Cartons Opened for Inspection:8CTNS
List of Export Carton Numbers Opened:	3,15,28,31,41,49,58

	INSPECTION REPORT	Report Date:	Mar 25. 2008	Overall Result PASS
		Booking No.:	N/A	
		Inspection No.:	2003-01	
		Client Name:		6 pages

B.REMARKS	
1.	Approval sample was provided for this inspection.
2.	A shipment sample was kept by TTC.

C. INSPECTION CRITERIA					
Inspection Standard:		ANSI/ASQC Z1.4(formerly known as MIL-STD-105)			
Inspection Level-Workmanship/Visual:		G II	AQL-Critical Defectives:	0	
			AQL-Major Defectives:	2.5	
Sample Size-Workmanship/Visual:		200pcs	AQL-Minor Defectives:	4.0	
			AQL-Other:	N/A	
Description			Critical	Major	Minor
1.	Hair inside of ploy-bag			1	
2.	Noise from joint			1	
3.	Poor printing on logo				2
4.	Deformed base				2
5.	Scratch mark on painted surface				1
Total Found:			0	2	5
Total Allowed:			0	10	14
Result:			PASS	PASS	PASS

D. ON-SITE TESTS				
	Check Points		Findings	Result
1.	Description:	Function test	NO FAILURE	PASS
	Sample Size:	20 PCS		
2.	Description:	Carton drop test	NO FAILURE	PASS
	Sample Size:	1 Carton		


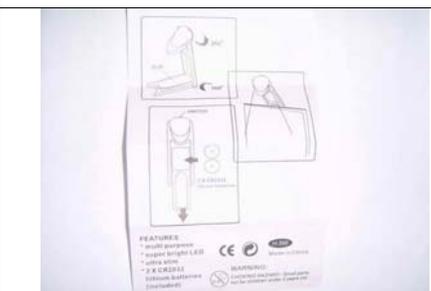
	INSPECTION REPORT	Report Date:	Mar 25. 2008	Overall Result PASS
		Booking No.:	N/A	
		Inspection No.:	2003-01	6 pages
		Client Name:		

E. PACKING & ASSORTMENT								
Packing								
Cartons	Quantity	Carton Size (cm)					Weight (Kgs)	Result
		Length	Width	Height	Other	Client Tolerance		
Export/Outer (given)	100	24.8	20	18.4	N/A	N/A	3.4	N/A
Export/Outer (actual)	100	25	20	18.6	N/A		3.6	
Assortment								
No. of Cartons Checked		No. of Cartons Failed		Findings / Comments			Result	
1		0		NO FAILURE			Pass	
Export Carton Details								
New or Used	NEW		Sealing	Opaque Gummed Tape		NO		
Material	PAPER CARD			Transparent Gummed Type		YES		
# Corrugated Paper Plies	5 PLIES			Paper Type		NO		
Fastening- Metal Staples	NO		Strapping	Nylon Band		YES		
Individual package: One piece packed into a ploy-bag..								
Result: PASS								

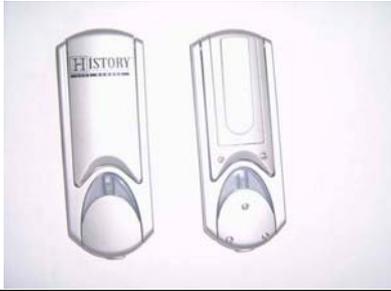
F. LABELING / PRINTING / MARKING			
Name	Location	Findings / Comments	Result
Logo	Product body	No failure	PASS
Result: PASS			

For the details, please see the following attached photos.

	INSPECTION REPORT	Report Date: Mar 25, 2008	Overall Result PASS
		Booking No.: N/A	
		Inspection No.: 2003-01	6 pages
		Client Name:	

Photo 1 	Photo 2 	Photo 3 
Finished products	Carton	Shipping mark
Photo 4 	Photo 5 	Photo 6 
Side mark	Packed into carton	Mark on inner box
Photo 7 	Photo 8 	Photo 9 
Packed into box	Ploy-bag packaging	Instruction sheet

	INSPECTION REPORT	Report Date: Mar 25. 2008	Overall Result PASS
		Booking No.: N/A	
		Inspection No.: 2003-01	6 pages
		Client Name:	

Photo 10	Photo 11	Photo 12
		
Product	Product	Products
Photo 13	Photo 14	Photo 15
		
Function test	Function test	Hair inside of ploy-bag
Photo 16	Photo 17	Photo 18
		
Poor printing on logo	Poor printing on logo	Scratch mark on painted surface

	INSPECTION REPORT	Report Date:	Mar 25. 2008	Overall Result PASS
		Booking No.:	N/A	
		Inspection No.:	2003-01	6 pages
		Client Name:		

Photo 19	Photo 20	Photo 21
	N/A	N/A
Deformed base	N/A	N/A

Approval by:	Vicky Lin
Date:	Mar 26. 2008